THERMOLEC

Acusteam Error Code 1

CAUTION

WARNING For electric shock
Disconnect all power before working within the unit

Must be performed by licensed technician

Acusteam error code 1

On the front LED panel, the red light flashes once?

NO

YES

The two water level sensors are miswired or cannot read the water level properly.

Turn power OFF. Check for proper wiring of high and low level sensors. Make sure two sensors are not reversed. Turn power ON (see fig 13a of manual)

Red light turns OFF and the humidifier starts working properly?

NO

YES

With tank empty when the humidifier drains, are LEDs LD1 and LD2 on E400 board lit?

NO

YES

Please call Thermolec tech support at 952-854-4400

No error code. The humidifier is working properly and follows the sequence of operation (section 20)

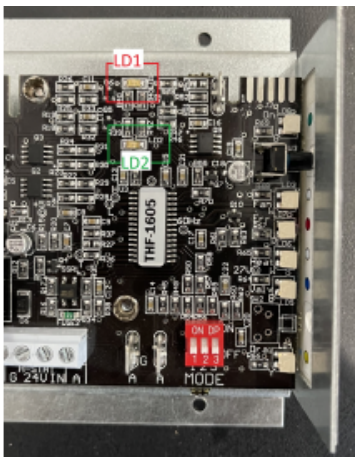

Replace corresponding sensor:
LD1: High level sensor
LD2: Low level sensor